



# SmartNav4 false contact repair

When the unit shows erratic behavior or the device isn't installing properly, you may look for a shortcut between its internal components.

Written By: Stefano Ficacci





## TOOLS:

- [Flathead 3/32" or 2.5 mm Screwdriver](#) (1)
  - [5/64" Allen Wrench](#) (1)
-

## Step 1 — Device opening




- Gently open the four plastic tongues with a small slotted screwdriver, you need to keep the black and silver plastic gently pulled apart.

## Step 2




- Once separated, there are four hex screw to be removed.
- I guess the size is 5/64" but I've used a 2 mm bit.

### Step 3

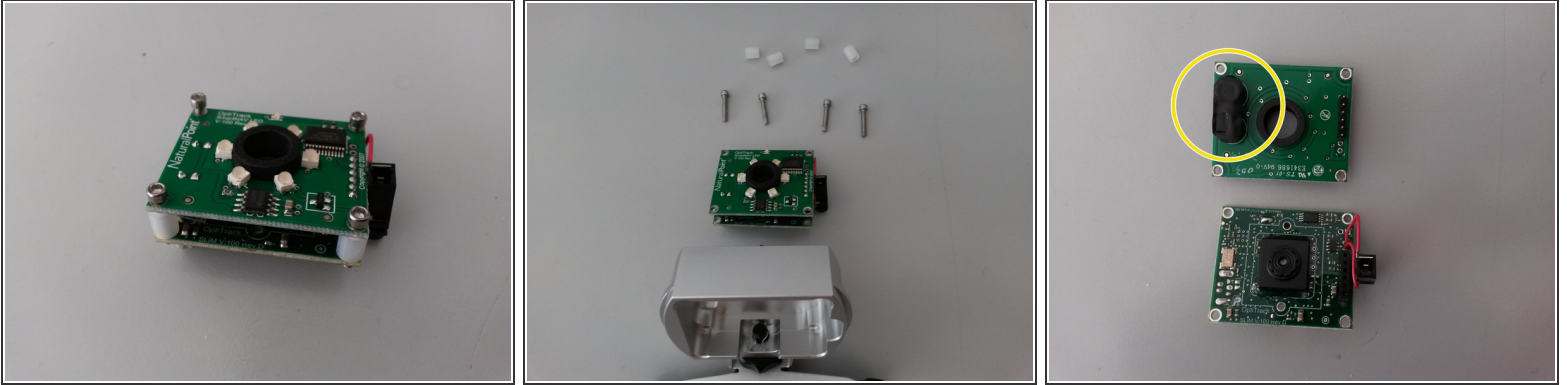

- Extract and separate the components.
- The problem it is located in the black film between the boards. Which is clearly pinched through.


### Step 4

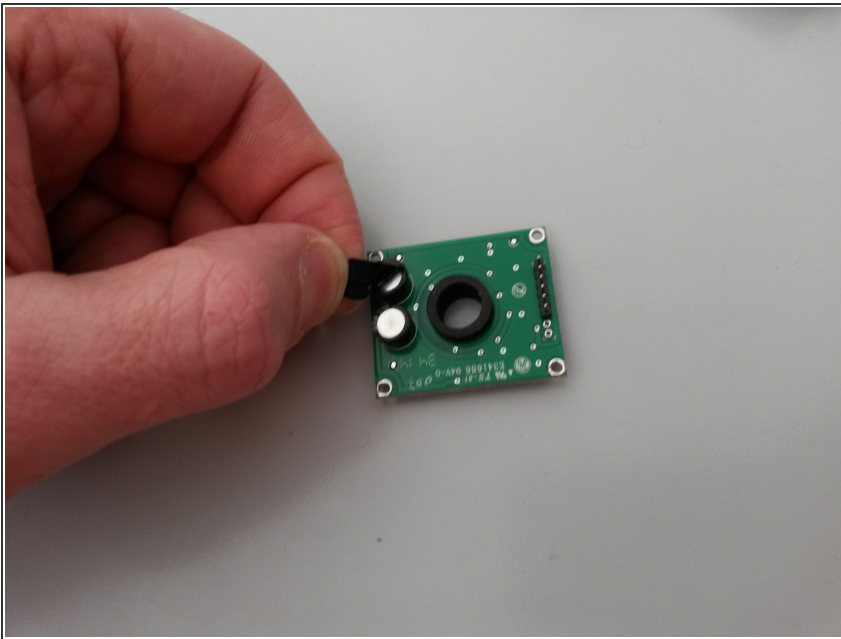

- Remove the tape.




## Step 5

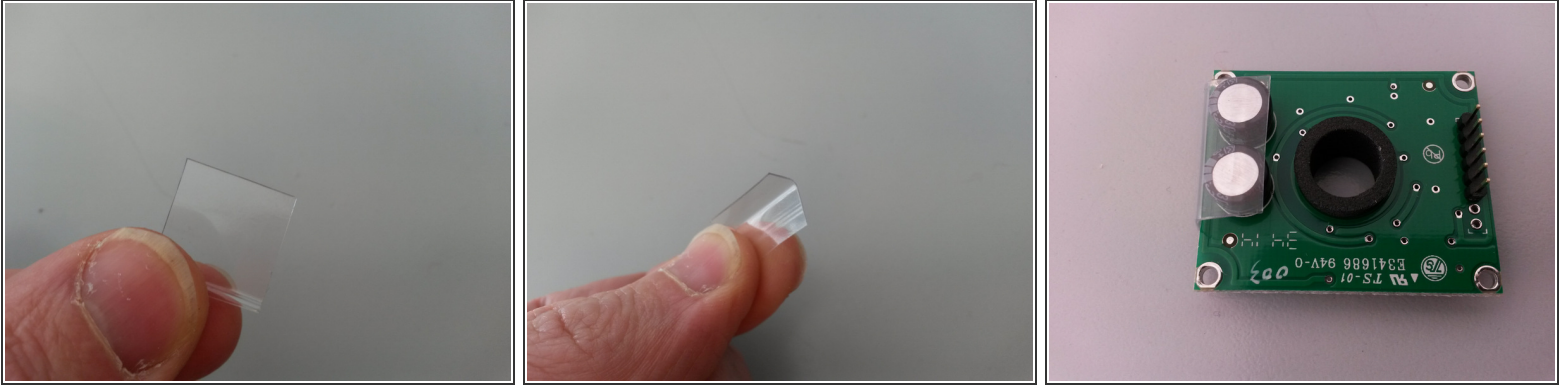

- Prepare a new divider. I've got this from a 0.4 mm rigid plastic
- I've then folded 90°
- I've placed and dimensioned in order to fit the position in the picture

## Step 6

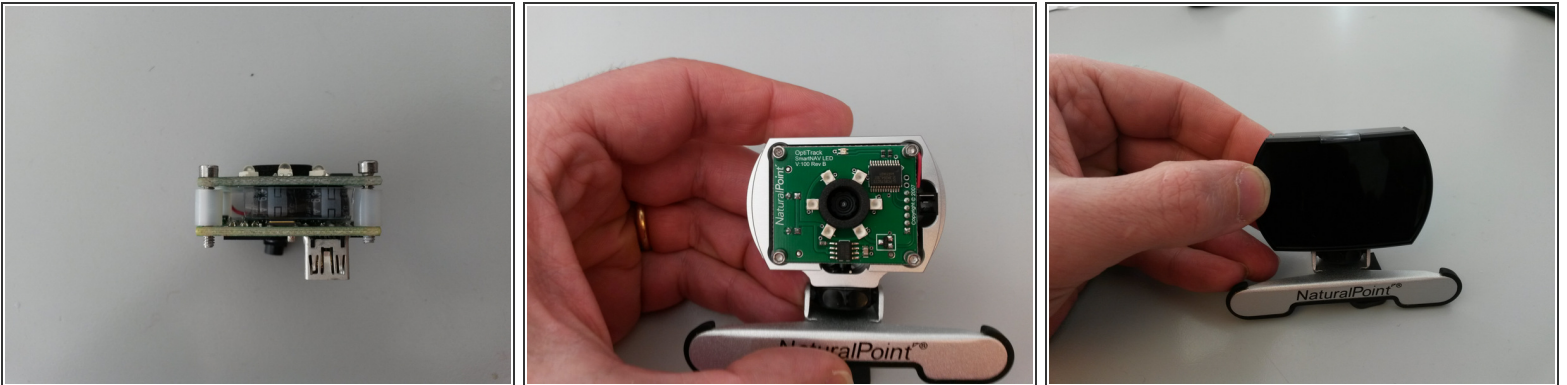

- Then it is only need to assemble everything as it was before

Per rimontare il dispositivo, segui queste istruzioni in ordine inverso.

This document was last generated on 2017-07-18 08:55:55 AM.